


Measuring / object data

Measurement no.:	17	Speed	: 3000 r/min	Diameter:	11.50 in
ID number	: 50234	Needle state:	---	Level	:
Drilling depth	: 13.02 in	Tilt	: -29°	Direction:	:
Date	: 03/31/2021	Offset	: 70 / 272	Species	:
Time	: 09:55:00	Avg. curve	: off / off	Location	:
Feed	: 40 in/min	Name	:		

WoodInspector

Program	: Pole - FIRST_E 1.10	Sum decay	: 28.4% 44.1% 72.5%
Pole type	: 3BGL	Heart rot	: 28.4% 44.1% 72.5%
Measurement	: Below soil level	Shell rot	: No No
Defect pattern	: Heart rot	Remaining wall	: 21.6% 5.9% 13.8%
Result (auto)	: PRIORITY 1 REJ	Strength	: 89.6% 39.5% 64.5%

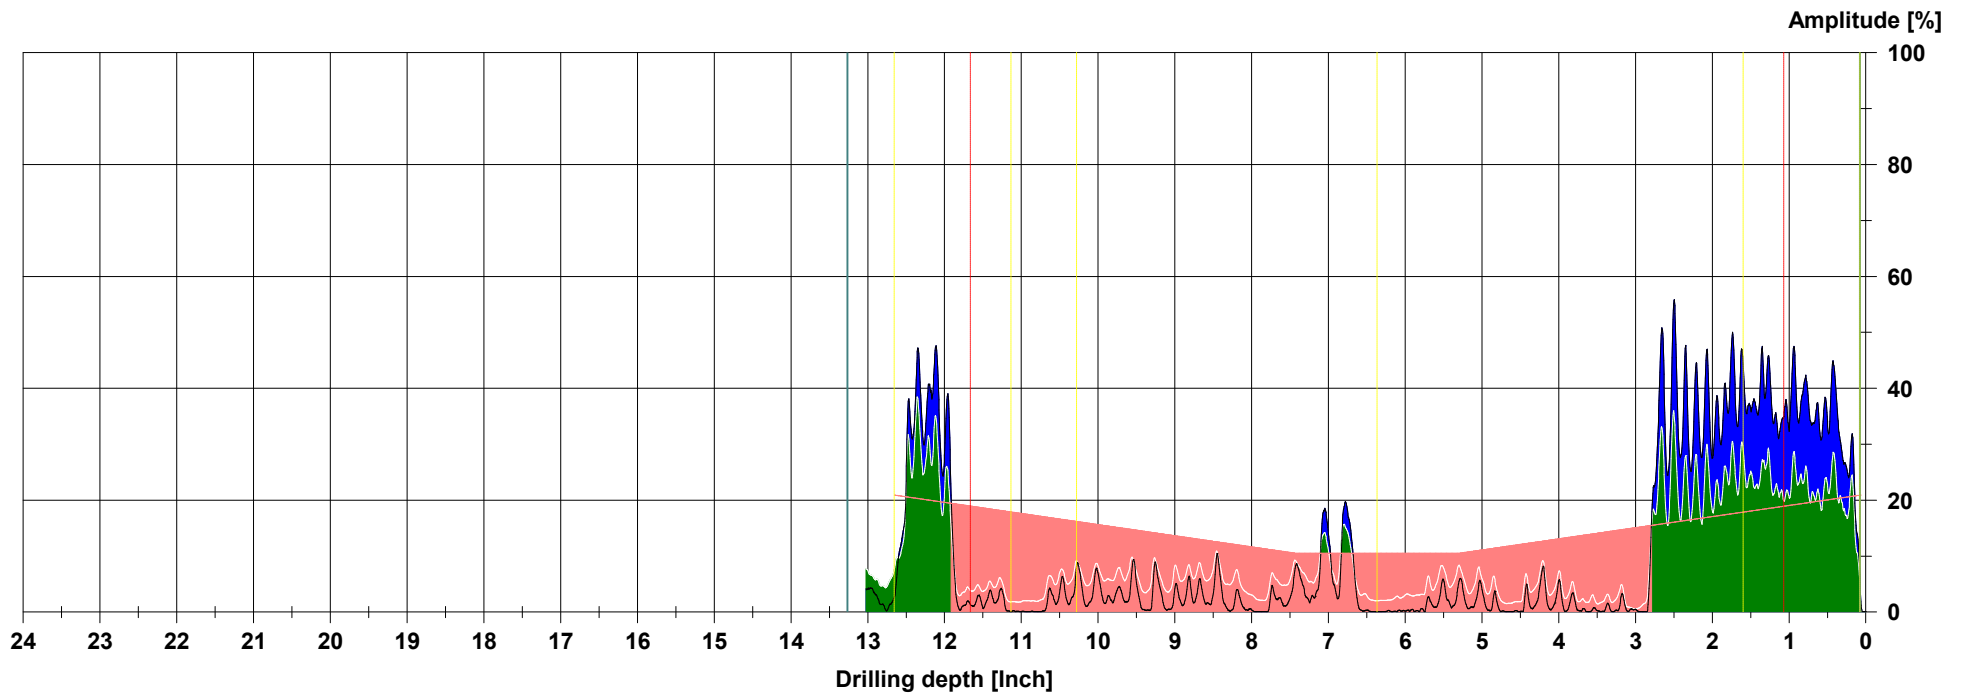

Assessment

Comment